


JOINT REPAIR - PCC PAVEMENT
NOT TO SCALE

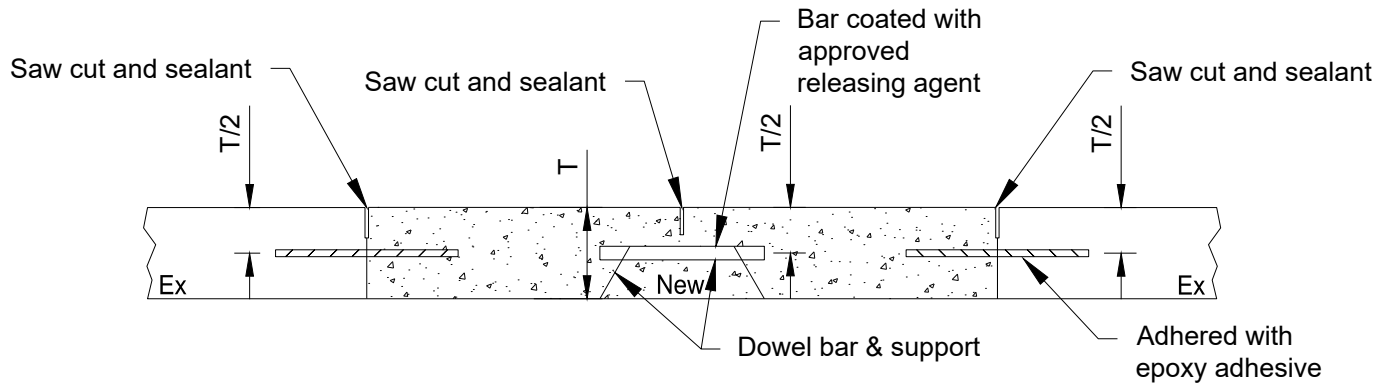

SECTION A - A

Notes:

1. T = Pavement thickness
2. All joints to be sealed.
3. All tie bars to be grade 40 steel.
4. All dowel, ties, reinforcing steel to be epoxy coated.
5. Maintain 3" concrete cover around all metals.
6. Pavement repairs shall match existing depths.
7. All sub-cut areas of base, sub-base, and subgrade must be approved by the engineer. Contractor shall not be paid for sub-cut quantities unless approval by the engineer is granted before work begins..
8. Pavement joints shall not have more than two sets of dowel bars.
9. Do not saturate the subgrade during sawing operations.
10. Dowel bars release agents shall be multipurpose lithium grease (NLGI grade #2), TECTYL 506 or approved equal.

City Plate No.: STR-17A
Last Revision: 6/17/2019
File: STR-17A.dwg

STANDARD DETAILS
CONCRETE PAVEMENT REPAIR
TRANSVERSE JOINT REPLACEMENT



M:\STANDARD SPECS & DETAILS\2019\Detail Plates\STR-17A_CONCRETE PAVEMENT REPAIR TRANSVERSE JOINT REPLACEMENT.dwg